

6-5-85

2-22-85

5S 1568-6E

CODE 41

CYLINDER SELECT ERROR

5.7L "Y" SERIES

FUEL INJECTION (PORT)


Due to the same ECM being used for different engine applications, it is necessary to ground selected pins in the ECM. For a V-8 application terminal D3 and D10 should be connected to engine ground.

A Code 42 will set if the reference pulses are not equal to a value selected within the MEM/CAL when RPM's are below 2000.

1. Checks to see if code was set as a result of hard failure or intermittent condition. If code

does not repeat, CKT 450 and connections should be carefully inspected.

CODE 41
CYLINDER SELECT ERROR
5.7L "Y" SERIES
FUEL INJECTION (PORT)

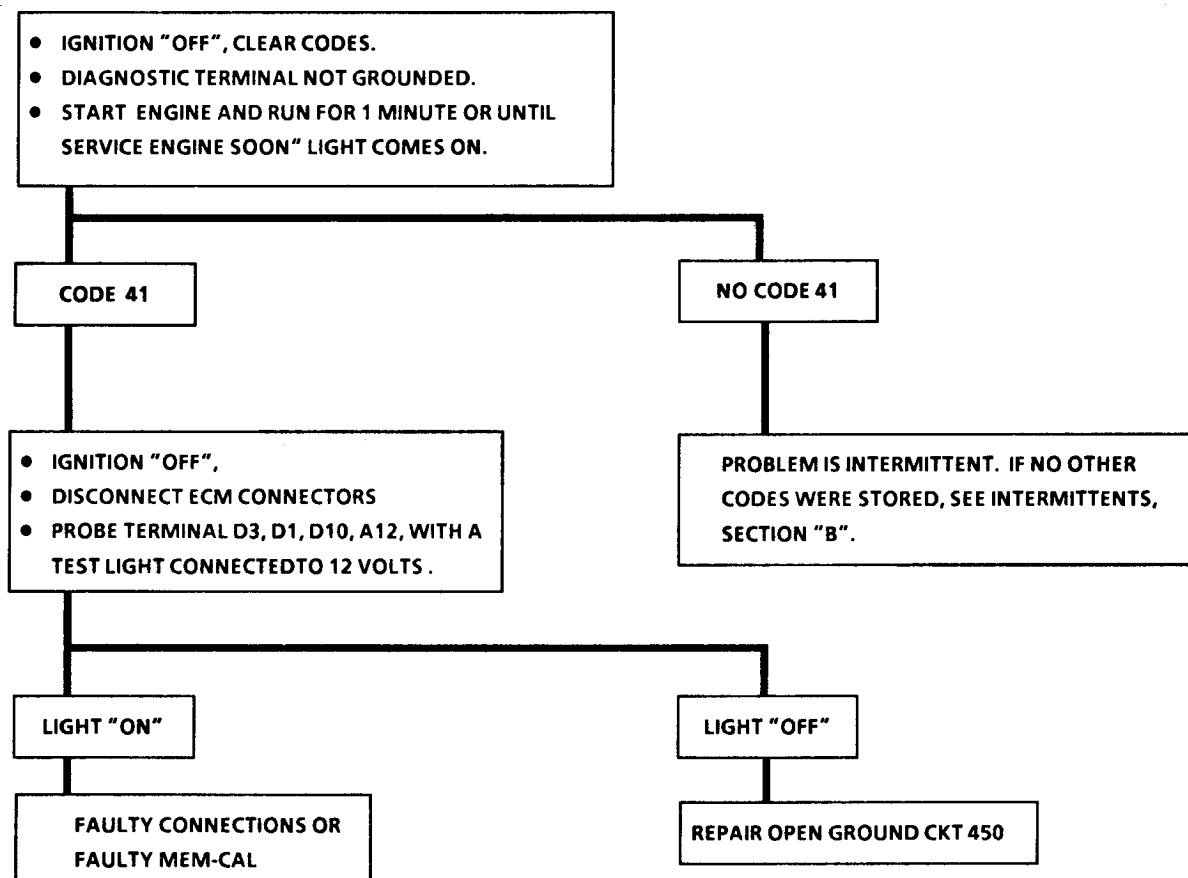

4-29-85

* 55 1569-6E