

Imray Correction Notice

22 February 2012

IC2600.10

Chart 2600+10 WGS 84

Edition May 2008

Date of printing May 2008

The following corrections should be noted:

1 Approaches to Milford Haven (*buoy moved - See ILNW 295/08*)

Move Y Lt buoy ODAS Turbot Bank Fl(5)Y.20s to 51°36'·00N 5°08'·70W (ILNW 245/08)

2 Approaches to Milford Haven

Move Y Lt buoy ODAS Turbot Bank Fl(5)Y.20s to 51°36'·70N 5°08'·70W (ILNW 295/08)

3 Approaches to Milford Haven (*buoy removed - see ILNW 386/09*)

Insert Y ODAS Lt buoy Fl.Y.2·5s in 51°36'·51N 5°08'·37W (ILNW 160/09)

4 Approaches to Milford Haven, Freshwater West

Insert dangerous underwater rock sym in:

51°38'·46N 5°03'·65W

51°39'·25N 5°04'·00W (ILNW 372/09)

5 Approaches to Milford Haven

Delete Y ODAS Lt buoy Fl.Y.2·5s in 51°36'·51N 5°08'·37W (ILNW 386/09)

6 Approaches to Milford Haven

Delete Y pillar Lt buoy Fl.Y.2·5s in 51°38'·2N 5°09'·0W (ILNW 97/10)

7 Jack Sound (Plan A)

Insert Y spher Lt buoy Fl(5)Y.20s in 51°44'·34N 5°16'·11W (ILNW 339/10)

8 Depths

Recent surveys have revealed depths less than charted in the vicinity of Skomer Island, Skokholm Island and Saint Ann's Head; in coastal areas between Linney Head and Saint Govan's Head; and at Saint Gowan Shoals.

Mariners are advised to navigate with caution in these areas.

Full details will be included on the next edition of this chart. (ILNW 33/12)

9 Skokholm Island

Reduce range of Lt to Fl.WR.10s54m8M in 51°41'·63N 5°17'·22W (ILNW 54/12)