

Imray Correction Notice

ICA13

11 September 2012

Chart A13 WGS 84

Edition May 1998

Date of printing Jun 2004

The following corrections should be noted:

1 Isla de Vieques, Sonda de Vieques

Delete Lt buoys: G can **No.1** in 18°13'·33N 65°28'·1W and R con **No.2** in 18°13'·05N 65°28'·85W.

Puerto Rico, Pasaje de Vieques

Delete Lt buoys: R con **No.6** Fl.R.2·5s in 18°10'·68N 65°36'·9W and G con **No.3** Fl.G.2·5s in 18°09'·7N 65°37'·55W.

Isla de Vieques, Radas Roosevelt

Delete R con Lt buoy **No.10** Fl.R.4s in 18°10'·1N 65°33'·2W (ILNW 296/04)

2 Isla de Culebra

Delete Lt LFl.6s6M at Pta Melones in 18°18'·2N 65°18'·7W (ILNW 102/05)

3 Puerto Rico, Ensenada Honda

Delete Ldg Lts:

Iso.6s142ft on Pta Puerca

Q.70ft9M on Islas Cabras and ldg line with lgd Ldg Lts 025°24'(True) (ILNW 120/05)

4 Isla de Culebra, Bajos Grampus

Move Lt buoy **No.2** to 18°15'·45N 65°11'·72W (ILNW 140/05)

5 Pasaje de Viques (Chart & Plan)

Delete G can Lt buoys:

No.1 Fl.G.6s in 18°11'·8N 65°36'·6W

No.11 Fl.G.4s in 5°11'·3N 65°34'·9W (ILNW 514/05)

6 Palmas del Mar (Inset) *(Further information - see ILNW 66/10)*

Mariners are advised that a marina has been established in the Outer Harbour. The basin has been dredged to a depth of around 3·7m accordingly. If well-handled, yachts up to 125' are said to be able to use the marina but, with strong southeast winds, entrance is tricky. (ILNW 167/09)

7 Bahia de Fajardo

Mariners are advised of the new Sunbay Marina, established in approximate position 18°20'·4N 65°38'·0E. The marina has all expected services, 282 berths and is suitable for boats up to 60'. Further details can be found at www.sunbaymarina.com (ILNW 168/09)

8 Palmas del Mar (Inset)

The new marina at Palmas del Mar has been upgraded, with all marina facilities - fuel, water, electricity, showers, launderette and yacht club - now available. (ILNW 66/10)

9 Puerto Patillas (Inset)

The entrance to Puerto Patillas is now buoyed. However, mariners are advised to use eyeball navigation in good light and to follow the sailing directions on the reverse of this chart. (ILNW 368/10)

10 Isla de Vieques, Pta Arenas northwards *(buoy removed - see ILNW 388/12)*

Insert G pillar Lt buoy **No.11** Fl.G.4s in 18°11'·35N 65°34'·90W (ILNW 5/12)

11 Isla de Vieques, Pta Arenas northwards

Delete G pillar Lt buoy **No.11** Fl.G.4s in 18°11'·32N 65°34'·91W (ILNW 388/12)

Edition May 1998

Date of printing Jan 2000

The following corrections should be noted:

- 1 *Note* All foreign vessels arriving in Puerto Rico must first obtain a cruising permit and report to

customs at every port of call.

Puerto Rico, eastwards, Vieques Sound Move port can Lt buoy Fl.G.2-5s No.3 to 18°11'·4N 65°28'·5W (ILNW 3152/00)

2 Isla de Vieques, south coast

Delete Lt Fl.4s68ft7M at Pta Ferro in 18°05'·8N 65°24'·45W (238/03)

3 Isla de Vieques, Ensenada Honda

Delete Lt Fl.6s56ft7M in 18°06'·5N 65°22'·6W (ILNW 281/03)

Edition May 1998

Date of printing May 1998

The following corrections should be noted:

1 Puerto Yabucoa

Amend Lts: Q.75ft to Q.G.75ft in 18°03'·39N 65°50'·2W and Iso.6s140ft to Iso.G.6s140ft WNW. (ILNW 1580/98)