

# Imray Correction Notice

24 May 2012

ICD21

## Chart D21 WGS 84

*Edition Apr 2007*

*Date of printing Apr 2007*

The following corrections should be noted:

### 1 Puerto Cabello eastwards

Insert S card Lt buoy Q(6)+LFI.15s in 10°29'·13N 67°57'·13W (ILNW 301/07)

### 2 Cabo Codera (Main chart & Plan E) (Correction amended - see ILNW 376/11)

Amend Lt to FI.6s551ft13M in 10°34'·2N 66°03'·2W (ILNW 484/08)

### 3 La Guaira (Main chart & Plan B) (Correction amended - see ILNW 24/12)

Amend breakwater Lts:

FI.G.3·7s46ft8M to FI.G.3s46ft13M on North Mole

FI.R.2·5s42ft8M to FI.R.2·5s42ft13M on South Wall

FI.R.3s49ft8M to FI.R.3s49ft15M at Punta Maiquetia (ILNW 42/09)

### 4 Arrecife

Delete Lt FI.R in 10°35'·4N 67°04'·8W (ILNW 53/09)

### 5 Puerto Chichiriviche and Parque National Morrocoy (Plan B)

All channel markers in the approaches to both Morrocoy and Chichiriviche are reportedly missing.

Depths in the approaches to Morrocoy are reportedly less than charted. Mariners are therefore advised to proceed with caution. (ILNW 88/10)

### 6 Chichiriviche (Plan B)

Delete overhead power cable in the inner harbour at Chichiriviche. (ILNW 89/10)

### 7 General Notice

Before visiting this area, mariners are advised to check [www.safetyandsecuritynet.com](http://www.safetyandsecuritynet.com).

The Venezuelan HO changes light characteristics on a regular basis, making it difficult to keep corrections up to date. Lights are seldom moved, but characteristics are regularly changed. (ILNW 138/10)

### 8 Bahia de Turiamo

Amend Lt FI.15s6M to LFI.7s6M in 10°27'·20N 67°50'·68W (ILNW 375/11)

### 9 Cabo Codera (Main chart & Plan E)

Amend Lt FI.6s551ft13M to FI.2·5s551ft13M in 10°34'·2N 66°03'·2W (ILNW 376/11)

### 10 Farallon Centinela

Amend Lt FI.12s145ft19M to FI.12s124ft25M in 10°48'·9N 66°05'·6W (ILNW 377/11)

### 11 Puerto Cabello

Reduce range of Solano Lt FI(3)15·5s550ft30M to 25M in 10°27'·9N 68°01'·2W (ILNW 22/12)

### 12 Morro Choroní

Amend Lt FI.5s328ft10M to FI.5s347ft18M in 10°30'·7N 67°36'·2W (ILNW 23/12)

### 13 Puerto La Guaira (Main chart & Plan B)

Amend Lt at S breakwater to FI.3s49ft15M [FI.15M on main chart] in 10°36'·13N 66°57'·23W (ILNW 24/12)

### 14 Puerto Cabello (Plan C)

Delete Lt FI.G.7s10M in 10°29'·15N 68°00'·57W (ILNW 170/12)

### 15 Puerto Cabello, Pta Brava (Main chart & Plan C)

Amend duration of Lt FI.10s121ft20M to 6s in 10°29'·44N 68°00'·50W and delete radar bn Racon(V). (ILNW 171/12)

**16 Approaches to Puerto Cabello**

Amend Lt Fl.7s4M to Fl.G.3s10M in 10°29'43N 68°05'72W

Delete Lt Fl.R in 10°29'28N 68°02'13W

Delete lit mooring buoy Fl.10s in 10°31'71N 68°10'78W

Insert dangerous wk sym in 10°33'40N 68°03'61W (ILNW 196/12)

**17 Higuero (Main chart & Plan G)**

Delete Lt Fl.R in 10°29'2N 66°06'0W (ILNW 199/12)