Service Bulletin No. 54




Data East Pinball, Inc. 1990 Janice Avenue Melrose Park, IL 60160

Tel: 1-800-KICKERS or Tel: 708-345-7700

Fax: 708-345-0010

Technical Support

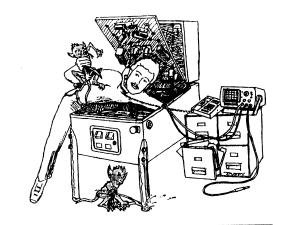

Joe Blackwell, Technical Support Manager Eric Winston, Technical Support Engineer Jay Alfer, Technical Documentation Administrator

TO:

Service Managers

DATE:

March 23, 1994

RE:

Jurassic Park, Last Action Hero & Tales from the Crypt

FLIPPER / END OF STROKE FAILURES

Symptom: Lower Flipper not working, or working intermittently when flippers are used.

Problem: End of stroke switches are failing. This is due to the switch blade cracking. The cracks are known to be occuring between the baka-lite wafers, which in turn isolate the switch blades from each other; therefore, not making the switch failure visible to the eye. The failure can be diagnosed by attaching a jumper wire across the switch lugs and retesting the flippers under power.

Solution 1: *Replace* with E.O.S. Power Switch Update Kit, 500-5821-00 (Kit includes or, E.O.S. Switch, 180-5124-01, Spacer and instructions).

Solution 2: Replace Solid State Flipper Board part #520-5033-03 with the new updated Solid State Flipper Board, part #520-5076-00. The new Flipper Board has a modified circuit, which prevents the failure of the flippers if the End of Stroke Switch fails.

« Note: Solution 2 is an option, not a warranty item! »>

Solution 3: *Modify* existing Flipper Board, part #520-5033-03. This update to the old board modifies the circuitry which prevents the failure of the flippers if the End of Stroke Switch fails.

See next page for step-by-step procedures if Solution 3 is chosen.

or,

The following is the step by step procedure for Solution 3:

Parts Required:

Two (2) each 1MFD 50V Electrolytic Cap.

Two (2) each 1N4148 Diode

Two (2) 4.7K 1/4w Carbon Resistor

One (1) 1" Solid Wire, 22 Gauge or smaller.

Tools Recommended:

Exacto Knife

Soldering Iron (25w) Solder 60/40 Rosin Core

Flush Cutters Long Nose Pliers

Modification Procedure:

Step 1 A) Remove flipper bd. # 520-5033-03 from game cabinet.

B) Cut the trace (bottom side) that connects R23 & R25. (See Fig. 1)

C) Add jumper (bottom side) from cut side of R23 Ground. (See Fig. 1)


- Step 2 A) Right Flipper: Take the 1MFD 50V Capacitors and attach 1 cap. to CN1, {+} (positive) side to Pin 2 and {-} (negative) side to Pin 1. (See Fig. 1)
 - B) Left Flipper: Attach the second cap. to CN1, {+} side to Pin 9 and {-} side to Pin 11. (See Fig. 1).
- Step 3 A) Add resistors and diodes to the topside. (See Fig. 2)
 - B) Attach by twisting and soldering one lead of each resistor to the cathode (banded side) of the diode. Do this to both diodes.
 - C) Attach the resistor / diode set. Cut and solder the anode lead (non banded side) to IC location U1 Pin 4, solder the other end of the resistor / diode to location R1 (See Fig. 2 Left shaded area). This takes care of the right flipper.
 - D) Attach the 2nd resistor / diode set. Cut and solder the anode lead (non banded side) to IC location U2 Pin 4, solder the other end of the resistor /diode to location R23 (See Fig. 2 Right shaded area). This takes care of the left flipper.

CAUTION:

USE EXTREME CARE WHEN HANDLING SOLDERING IRON OR SHARP OBJECTS.

Any questions or concerns call us at 1-708-345-7700 and ask for Service.

Bottom Side

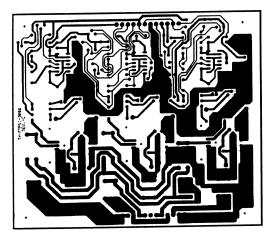



DATA EAST PINBALL, INC. Solid State 3-Flipper Board 520-5033-03 Rev. C compatible to 520-5076-00 Rev. A after modifications

Top Side

