



**FAA**  
**Aviation Safety**

# **EMERGENCY AIRWORTHINESS DIRECTIVE**

[www.faa.gov/aircraft/safety/alerts/](http://www.faa.gov/aircraft/safety/alerts/)

---

**DATE: November 7, 2018**

**AD #: 2018-23-51**

Emergency Airworthiness Directive (AD) 2018-23-51 is sent to owners and operators of The Boeing Company Model 737-8 and -9 airplanes.

## **Background**

This emergency AD was prompted by analysis performed by the manufacturer showing that if an erroneously high single angle of attack (AOA) sensor input is received by the flight control system, there is a potential for repeated nose-down trim commands of the horizontal stabilizer. This condition, if not addressed, could cause the flight crew to have difficulty controlling the airplane, and lead to excessive nose-down attitude, significant altitude loss, and possible impact with terrain.

## **FAA's Determination**

We are issuing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design. Due to the need to correct an urgent safety of flight situation, good cause exists to make this AD effective in less than 30 days.

## **AD Requirements**

This AD requires revising certificate limitations and operating procedures of the airplane flight manual (AFM) to provide the flight crew with runaway horizontal stabilizer trim procedures to follow under certain conditions.

## **Interim Action**

We consider this AD interim action. If final action is later identified, we might consider further rulemaking then.

## **Authority for this Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

**Presentation of the Actual AD**

We are issuing this AD under 49 U.S.C. Section 44701 according to the authority delegated to me by the Administrator.

**2018-23-51 The Boeing Company:** Product Identifier 2018-NM-151-AD.

**(a) Effective Date**

This Emergency AD is effective upon receipt.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all The Boeing Company Model 737-8 and -9 airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight controls.

**(e) Unsafe Condition**

This AD was prompted by analysis performed by the manufacturer showing that if an erroneously high single angle of attack (AOA) sensor input is received by the flight control system, there is a potential for repeated nose-down trim commands of the horizontal stabilizer. We are issuing this AD to address this potential resulting nose-down trim, which could cause the flight crew to have difficulty controlling the airplane, and lead to excessive nose-down attitude, significant altitude loss, and possible impact with terrain.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Revision of Airplane Flight Manual (AFM): Certificate Limitations**

Within 3 days after receipt of this AD, revise the Certificate Limitations chapter of the applicable AFM to include the information in figure 1 to paragraph (g) of this AD.

**Figure 1 to paragraph (g) of this AD – *Certificate Limitations***

**Required by AD 2018-23-51**

**Runaway Stabilizer**

In the event of an uncommanded horizontal stabilizer trim movement, combined with any of the following potential effects or indications resulting from an erroneous Angle of Attack (AOA) input, the flight crew must comply with the Runaway Stabilizer procedure in the Operating Procedures chapter of this manual:

- Continuous or intermittent stick shaker on the affected side only.
- Minimum speed bar (red and black) on the affected side only.
- Increasing nose down control forces.
- IAS DISAGREE alert.
- ALT DISAGREE alert.
- AOA DISAGREE alert (if the option is installed).
- FEEL DIFF PRESS light.
- Autopilot may disengage.
- Inability to engage autopilot.

**(h) AFM Revision: Operating Procedures**

Within 3 days after receipt of this AD, revise the Operating Procedures chapter of the applicable AFM to include the information in figure 2 to paragraph (h) of this AD.

**Figure 2 to paragraph (h) of this AD – Operating Procedures**

<b>Required by AD 2018-23-51</b>
<p><b><u>Runaway Stabilizer</u></b></p> <p>Disengage autopilot and control airplane pitch attitude with control column and main electric trim as required. If relaxing the column causes the trim to move, set stabilizer trim switches to CUTOUT. If runaway continues, hold the stabilizer trim wheel against rotation and trim the airplane manually.</p> <p>Note: The 737-8/-9 uses a Flight Control Computer command of pitch trim to improve longitudinal handling characteristics. In the event of erroneous Angle of Attack (AOA) input, the pitch trim system can trim the stabilizer nose down in increments lasting up to 10 seconds.</p> <p>In the event an uncommanded nose down stabilizer trim is experienced on the 737-8/-9, in conjunction with one or more of the indications or effects listed below, do the existing AFM Runaway Stabilizer procedure above, ensuring that the STAB TRIM CUTOUT switches are set to CUTOUT and stay in the CUTOUT position for the remainder of the flight.</p> <p>An erroneous AOA input can cause some or all of the following indications and effects:</p> <ul style="list-style-type: none"><li>• Continuous or intermittent stick shaker on the affected side only.</li><li>• Minimum speed bar (red and black) on the affected side only.</li><li>• Increasing nose down control forces.</li><li>• IAS DISAGREE alert.</li><li>• ALT DISAGREE alert.</li><li>• AOA DISAGREE alert (if the option is installed).</li><li>• FEEL DIFF PRESS light.</li><li>• Autopilot may disengage.</li><li>• Inability to engage autopilot.</li></ul> <p>Initially, higher control forces may be needed to overcome any stabilizer nose down trim already applied. Electric stabilizer trim can be used to neutralize control column pitch forces before moving the STAB TRIM CUTOUT switches to CUTOUT. Manual stabilizer trim can be used before and after the STAB TRIM CUTOUT switches are moved to CUTOUT.</p>

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(j) Related Information**

For further information about this AD, contact Douglas Tsuji, Senior Aerospace Engineer, Systems and Equipment Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3548; email: Douglas.Tsuji@faa.gov.

Issued in Des Moines, Washington, on November 7, 2018.

Original signed by  
Chris Spangenberg,  
Acting Director,  
System Oversight Division,  
Aircraft Certification Service.